

Erledigt

Designare Z390 / I9 9900 K / Radeon Vega 64 - EFI File Problem ?

Beitrag von „JimSalabim“ vom 10. August 2019, 18:03

Ich hab gerade in [Post# 2](#) wieder ein Update reingeladen. Aktuelle Clover-Version 5033, ansonsten habe ich keine Änderungen gemacht, soweit ich mich erinnern kann.

[Maclio](#)

Ich glaube, dein Problem ist folgendes:

Hast du beim Anschließen der SATA-SSD darauf geachtet, dass sich der M2M-Anschluss die Bandbreite mit den SATA3-Anschlüssen Nr. 4 und 5 teilt und der M2P-Anschluss mit Nr. 0 und 1?

Die SATA-SSD sollte also bei Verwendung von mehreren NVME an Anschluss Nummer 2 oder 3 angeschlossen werden, sonst geht es womöglich nicht.

Installation Notices for the M.2 and SATA Connectors:

Due to the limited number of lanes provided by the Chipset, the availability of the SATA connectors may be affected by the type of device installed in the M2 sockets. The M2M connector shares bandwidth with the SATA3 4, 5 connectors. The M2P connector shares bandwidth with the SATA3 0, 1 connectors. Refer to the following tables for details.

• M2M

Type of M.2 SSD	Connector	SATA3 0	SATA3 1	SATA3 2	SATA3 3	SATA3 4	SATA3 5
M.2 SATA SSD		✓	✓	✓	✓	✗	✗
M.2 PCIe SSD		✓	✓	✓	✓	✗	✗
No M.2 SSD installed		✓	✓	✓	✓	✓	✓

✓ Available, ✗ Not available

• M2P

Type of M.2 SSD	Connector	SATA3 0	SATA3 1	SATA3 2	SATA3 3	SATA3 4	SATA3 5
M.2 SATA SSD		✓	✗	✓	✓	✓	✓
M.2 PCIe SSD		✗	✓	✓	✓	✓	✓
No M.2 SSD installed		✓	✓	✓	✓	✓	✓

✓ Available, ✗ Not available