

UHD 630 ruckelt

Beitrag von „OSX-Einsteiger“ vom 21. März 2021, 21:05


Hier stimmt was nicht , du hast DVI Type eingestellt

Code

1. <04 00 00 00> DVI (Dual Link)



Setting Name	Type	Value
AAPL_GbVTitle	Daten	0
AAPL_Ig_platform-id	Daten	00000000
framebuffer-con0-busid	Daten	01000000
framebuffer-con0-enable	Daten	01000000
framebuffer-con0-flags	Daten	C7030000
framebuffer-con0-index	Daten	01000000
framebuffer-con0-type	Daten	04000000
framebuffer-con1-busid	Daten	02000000
framebuffer-con1-enable	Daten	01000000
framebuffer-con1-flags	Daten	C7030000
framebuffer-con1-index	Daten	02000000
framebuffer-con1-type	Daten	04000000
framebuffer-con2-busid	Daten	04000000
framebuffer-con2-enable	Daten	01000000
framebuffer-con2-flags	Daten	C7030000
framebuffer-con2-index	Daten	03000000
framebuffer-con2-type	Daten	04000000
framebuffer-patch-enable	Daten	01000000
graphics-options	Daten	9C000000

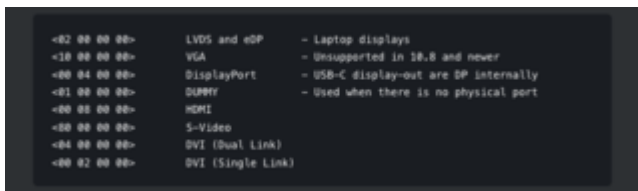

<02 00 00 00>	LVDS and eDP	- Laptop displays
<10 00 00 00>	VGA	- Unsupported in 10.8 and newer
<00 04 00 00>	DisplayPort	- USB-C display-out are DP internally
<01 00 00 00>	DUMMY	- Used when there is no physical port
<00 08 00 00>	HDMI	
<00 00 00 00>	S-Video	
<04 00 00 00>	DVI (Dual Link)	
<00 02 00 00>	DVI (Single Link)	